



## V570 Prep and Application

Steps of Surface Preparation and Application:

- 1) Wet-vac the surface area to remove water and all loose debris
- 2) Using a wire brush, remove all rust flakes and rust deposits. The goal is to remove unwanted debris and to provide a “tooth” for the product to adhere to.
- 3) Locate any pinhole leaks visually during the cleanup process. For small pinholes, duct tape can be used to cover those and for the larger holes a piece of sheet metal that has been abraded by wire brushing would be best. Be sure the edges are taped down so the product does not escape under it.
- 4) **Be sure to plug the drain!!!**
- 5) Open both cans of V570 and begin mixing Part A with Part B back and forth for 20 or more times.
- 6) Once mixing is complete, the product is ready to be applied by brush for the bottom of the pan and vertical surfaces.
- 7) Depending on the temperature in the room and the surface, allow V570 to cure 5-7 hours before applying Pancrete. **Keep in mind, that the hotter the temps the faster the cure time.**